FH63 Series



■Features

1. Automatic single action locking design

- · Single action locking by simply inserting FPC after mounting contributes to enhanced workability. (Fig.1)
- (Lock release by operating the lock lever when removing.)
- Operation of the lock lever is not required at the time of mating FPC. Can be inserted with one hand.

Contributes to reduced assembly time.

The lock lever will not be damaged by operation.

Mating failure is reduced by eliminating the need to operate a lever while mating.

2. Two-points of contact prevents contact failure by dust

 High contact reliability by independent spring two-point contact design, preventing contact failure by dust. (Fig.2)

3. Supports FPC/FFC/Shield FFC

- · FH63 allows you to choose from FPC/FFC/Shield FFC.
- · Shielded FFC is acceptable for EMI prevention. (Fig.3)

4. High FPC retention force

 The circuit is automatically locked after FPC/FFC is inserted by a single action. The notches on both sides of FPC are held by the lock lever, generating a high FPC retention force in spite of the small contact. (Fig.4)

5. Visual inspection on the mated status of FPC/FFC is possible.


· As the notches on both sides of FPC can be checked from the top surface after inserting FPC/FFC, insufficient insertion during assembly is prevented. (Fig.5)


6. Environmental

- · Halogen free
- *AS defined by IEC 61249-2-21.


Br:900ppm max, Cl:900ppm max, Br+Cl:1,500ppm max

FPC/FFC can be checked from the top surface after mating. NG Mated condition (correct position) Insufficient insertion condition (incorrect position) Fig.5

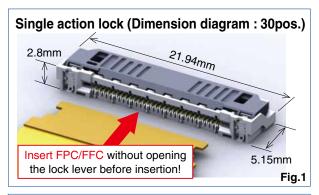

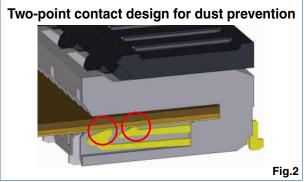



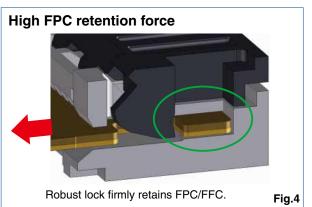

■Product Specifications

	•					
Rating	Rated current 0.5A Rated voltage 50V AC/DC rms	Operating temperature range : -58 Operating humidity range : Relativ (No co		Storage temperature range : -10°C to +60°C (Note 2) Storage humidity range : Relative humidity 90% max. (No condensation)		
Adaptive FPC contact specifications Thickness: = 0.33 ± 0.03 mm Signal layout: Gold plated, GND plate: Tin plated						
Item	Specif	ication		Conditions		
1. Insulation resistance	500MΩ min.		100V DC			
2. Withstanding voltage	No flashover or insulation	breakdown	150V AC rms / 1	minute		
3. Contact resistance	100mΩ max. ★ Including FPC/FFC con	ductor resistance	1mA AC			
4. Durability (insertion / withdrawal)	Contact resistance : 100n No damage, cracks, or pa		10 cycles			
5. Vibration	No electrical discontinuity Contact resistance : 100n No damage, cracks, or pa	nΩ max.	Frequency: 10 to 55Hz, single amplitude of 0.75mm, 10 cycles in each of the 3 directions			
6. Shock	No electrical discontinuity Contact resistance : 100n No damage, cracks, or pa	ηΩ max.	Acceleration of 981m/s², duration of 6 ms, sine half-wa waveform, 3 cycles in each of the 3 axes			
7. Damp heat (Steady state)	Contact resistance : 100n Insulation resistance : 50l No damage, cracks, or pa	MΩ min.	96 hours at temperature of 60°C and humidity of 90% to 95%			
8. Temperature cycle	Contact resistance : 100n Insulation resistance : 50l No damage, cracks, or pa	MΩ min.	Temperature : $-55^{\circ}\text{C} \rightarrow +15^{\circ}\text{C} \text{ to } +35^{\circ}\text{C} \rightarrow +105^{\circ}\text{C} \rightarrow +15^{\circ}\text{C} \text{ to } +35^{\circ}\text{C} \rightarrow +15^{\circ}\text{C} \rightarrow +15^{\circ}\text{C}$			
Resistance to soldering heat	No deformation of compo performance	nents affecting	Reflow : Recommended Temperature Profile Manual soldering: 350 ± 10°C for 5 seconds			

Note 1: Includes temperature rise caused by current flow.

Note 2: The term "storage" refers to products stored for long period of time prior to mounting and use. Operating Temperature Range and Humidity Range covers non-conducting condition of installed connectors in storage, shipment or during transportation.

■Materials / Finish


Part	Materials	Finish	UL standard
Insulator	LCP	Grey	UL94V-0
Insulator	LCP	Black	UL94V-0
Signal contact	Copper alloy	Nickel barrier gold plated	
Grounding contact	Copper alloy	Pure tin reflow plated	
Reinforcing metal tabs	SUS	Pure tin reflow plated	

■Product Number Structure

Refer to the chart below when determining the product specifications from the product number. Please select from the product numbers listed in this catalog when placing orders.

5 Terminal type				
SH ··· SMT horizontal mounting type				
6 Specification				
Blank : Standard 3,500pcs/reel (99) : 500pcs/reel				

■Connector Dimensions

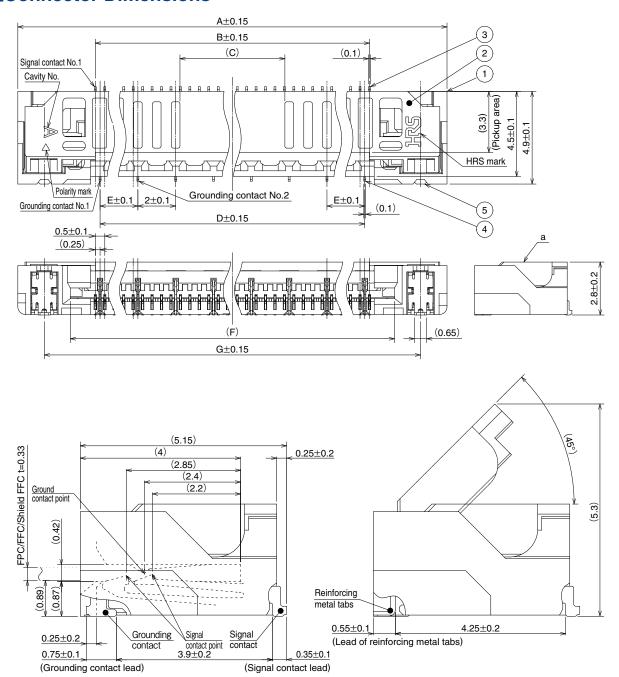


Note

- 1 : The dimension in parentheses are for reference.
- 2: Lead co-planarity including reinforced chucking metals shall be 0.1 max.
- 3: To be delivered with tape and reel packages. See the packaging specifications for details.
- 4: Note that preventive hole for sink mark or slit could be added for improvement.
- 5: The quality remains good, even with the dark spots, which could occasionally occur on molded plastic.
- 6: This product satisfies halogen free requirements defined as 900ppm maximum chlorine, 900ppm maximum bromine, and 1500ppm maximum total of chlorine and bromine.


Unit: mm

Part No.	HRS No.	No. of Contacts	Α	В	С	D	Е	F	G
FH63-10S-0.5SH	Under planning (Note 1)	10	12.7	4.5	5.55	4	2	7.15	9.9
FH63-20S-0.5SH	Under planning (Note 1)	20	17.7	9.5	6.55	9	1.5	12.15	14.9
FH63-30S-0.5SH	580-4400-0 **	30	22.7	14.5	5.55	14	2	17.15	19.9
FH63-40S-0.5SH	580-4403-0 **	40	27.7	19.5	10.55	19	1.5	22.15	24.9
FH63-50S-0.5SH	Under planning (Note 1)	50	32.7	24.5	15.55	24	2	27.15	29.9
FH63-60S-0.5SH	Under planning (Note 1)	60	37.7	29.5	20.55	29	1.5	32.15	34.9

Note 1: Contact positions without HRS No. are currently under planning. Please contact hirose for detailed information about product variation.

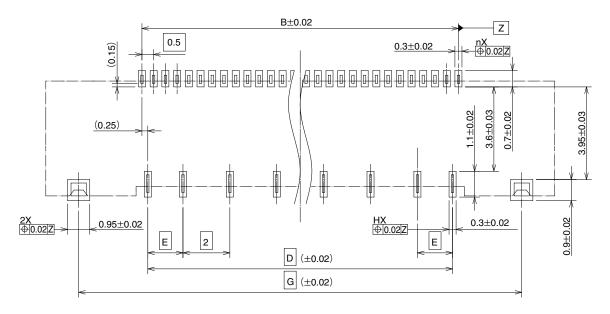

♠ Recommended Stencil Pattern

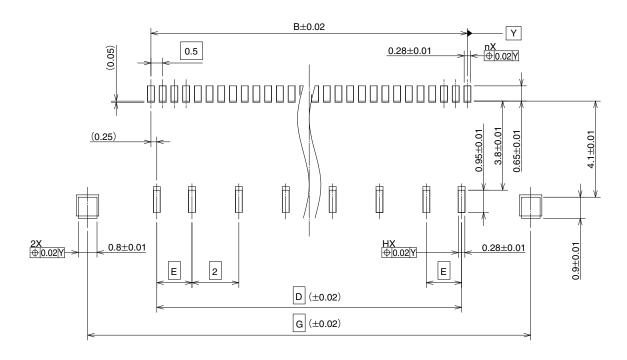


Note 7: 'n' shows the number of contacts.

Units: mm No. of Part No. HRS No. В D Ε G Н Contacts FH63-10S-0.5SH Under planning (Note 1) 4.5 2 3 10 4 9.9 FH63-20S-0.5SH Under planning (Note 1) 20 9.5 9 1.5 14.9 6 580-4400-0 ** FH63-30S-0.5SH 30 14.5 14 2 19.9 8 FH63-40S-0.5SH 580-4403-0 ** 40 19.5 19 1.5 24.9 11 FH63-50S-0.5SH Under planning (Note 1) 50 24.5 24 2 29.9 13 FH63-60S-0.5SH Under planning (Note 1) 60 29.5 29 1.5 34.9 16


Note 1 : Contact positions without HRS No. are currently under planning.

Please contact hirose for detailed information about product variation.

♠Recommended FPC/FFC Dimensions

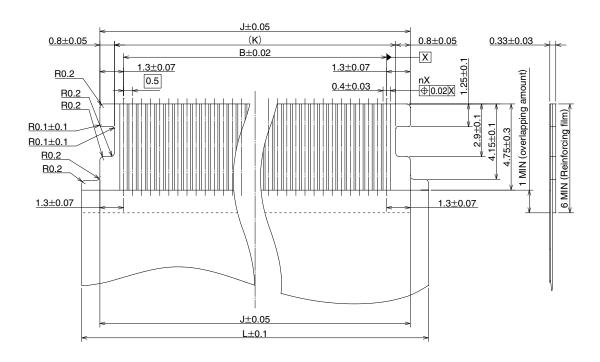

♠ Recommended Shield FFC Dimensions

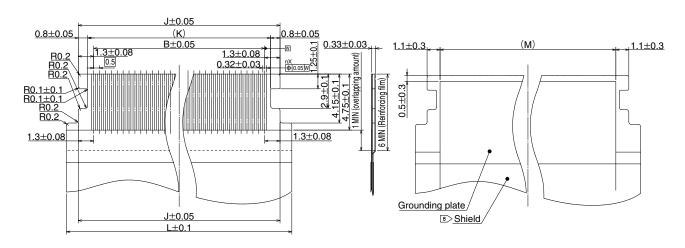

Note 7: The value 'n' indicates the number of pos.

8 Overlap the shield on the grounding plate.


Units: mm

Part No.	HRS No.	No. of Contacts	В	J	К	L	М
FH63-10S-0.5SH	Under planning (Note 1)	10	4.5	7.1	5.5	9.1	4.9
FH63-20S-0.5SH	Under planning (Note 1)	20	9.5	12.1	10.5	14.1	9.9
FH63-30S-0.5SH	580-4400-0 **	30	14.5	17.1	15.5	19.1	14.9
FH63-40S-0.5SH	580-4403-0 **	40	19.5	22.1	20.5	24.1	19.9
FH63-50S-0.5SH	Under planning (Note 1)	50	24.5	27.1	25.5	29.1	24.9
FH63-60S-0.5SH	Under planning (Note 1)	60	29.5	32.1	30.5	34.1	29.9

Note 1 : Contact positions without HRS No. are currently under planning.

Please contact hirose for detailed information about product variation.

Material composition of FPC/FFC/Shield FFC (Recommended specifications)

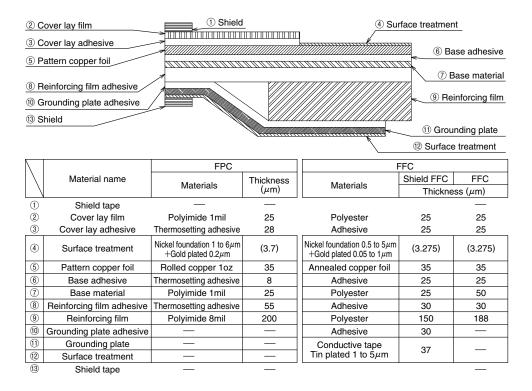


3. Caution

- 1. This specification is recommendation for the construction of the FH63 series FPC/FFC/Shield FFC $(t=0.33\pm0.03mm)$
- 2. For details about the construction, please contact FPC/FFC/Shield FFC manufactures.


● Packaging Specifications

●Embossed Carrier Tape Dimensions

tape width 24mm or less

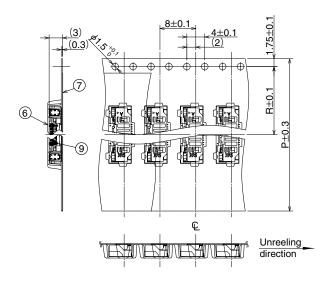


tape width 32mm or less

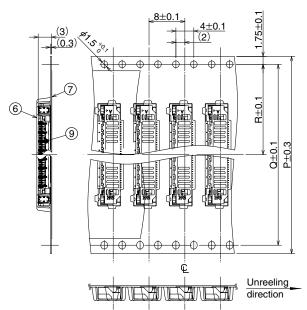

● Reel Dimensions

●Leader, Trailer Dimensions

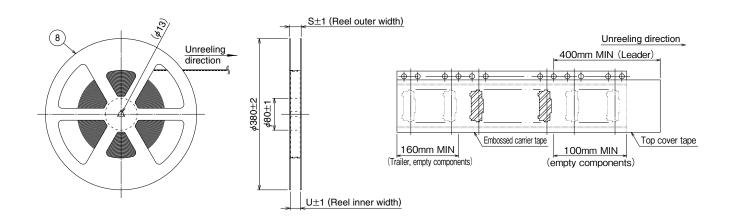

Note 9: 3500 pieces shall be packaged in one reel. (For standard products)

Note 10: The package complies with JIS C 0806 and IEC 60286-3 (Packaging of automotive mounting parts).


Unit: mm

Part No.	HRS No.	No. of Contacts	Р	Q	R	S	U
FH63-10S-0.5SH	Under planning (Note 1)	10	24		11.5	29.4	25.4
FH63-20S-0.5SH	Under planning (Note 1)	20	32	28.4	14.2	37.4	33.4
FH63-30S-0.5SH	580-4400-0 **	30	44	40.4	20.2	49.4	45.4
FH63-40S-0.5SH	580-4403-0 **	40	44	40.4	20.2	49.4	45.4
FH63-50S-0.5SH	Under planning (Note 1)	50	56	52.4	26.2	61.4	57.4
FH63-60S-0.5SH	Under planning (Note 1)	60	56	52.4	26.2	61.4	57.4

Note 1: Contact positions without HRS No. are currently under planning. Please contact hirose for detailed information about product variation.

KS 7

●Temperature Profile

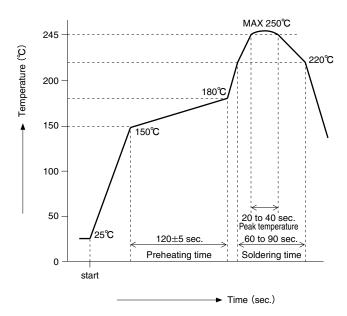

Applicable Conditions

Reflow method : IR/Hot air Reflow environment: Room air

Solder : Paste type Sn/3.0Ag/0.5Cu

(M705-GRN360-K2-V made by Senju

Metal Industry Co.)

Test PCB : PCB material and size

Glass epoxy 45×25×1mm

Land size, per recommended on page 4.

Metal mask : Thickness and opening size


Per recommended on page 4.


This temperature profile is based on the above conditions. It may vastly depending on solder paste type, manufacturer, PCB size and mounting materials. Please use only after checking the mounting conditions.

[Operation method]

Care needs to be taken when handling this connector. In order to prevent the damage and contact failure etc. (incorrect mating, disconnection of FPC pattern) of connectors and FPC, please use after confirming the following contents.

This connector supports FPC/FFC/Shield FFC, however, for convenience, the description is made only for FPC.

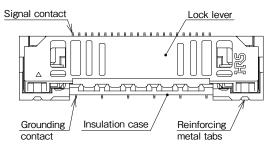

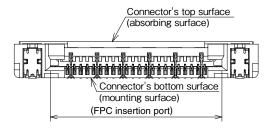


(Diagram of the connector's top surface)

(Diagram of the connector's front surface)

1. Delivered state

This product is delivered with the lock lever closed. The lock lever does not need to be operated before inserting FPC.

- Do not open the lock lever when FPC is not inserted.
 Additionally, the lock lever does not need to be opened except to remove the FPC. (Example 1)
- \cdot Do not operate the connector until it is mounted on the board. (Example 1)

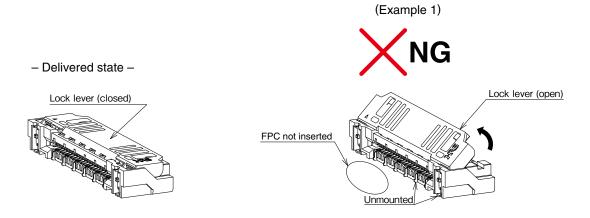


[Operation method]

2. How to insert FPC

Insert FPC to the end correctly (Ex.2) horizontal to the board surface.

- · Please confirm that the lock lever is closed when you insert FPC.
- Do not insert FPC while the lock lever is open. (Example 3)
- · Do not FPC while at the same time pressing the lock lever. (Example 4)
- · Insert FPC straight after positioning its tip end in a horizontal plane in reference to the guides on both ends of the connector mating port.
- · Insert in a manner that it won't be diagonal to the insertion direction. (Example 5)
- · When inserting, do not move the FPC in a vertical, lateral or diagonal direction. (Example 6)

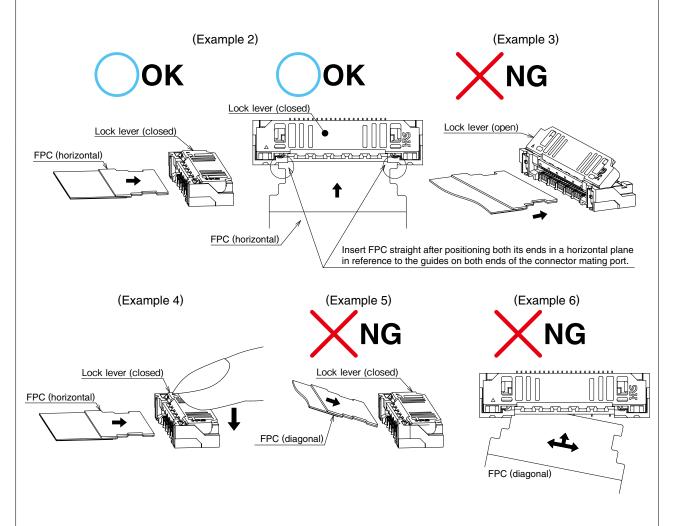



[Operation method]

3. Confirming the mated state of FPC

When FPC is completely inserted, visually inspect the inserted status of FPC. (Example 7) (This connector uses the lock protrusion of the lock lever for positioning FPC.)

- · FPC is not inserted deep enough or in a diagonal direction. (Example 8)(Example 9)
- · Because of the single action lock, The lever does not need to be operated after inserting FPC.

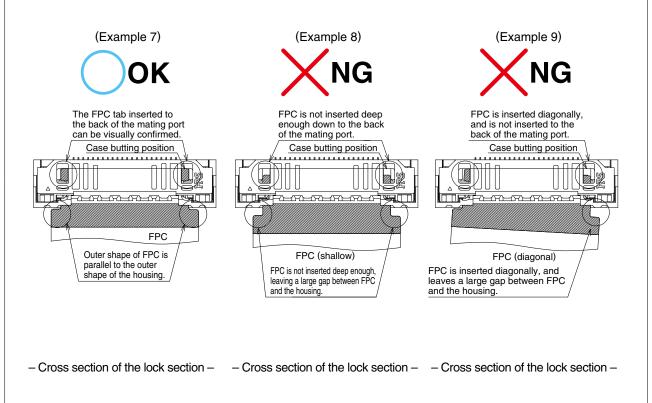

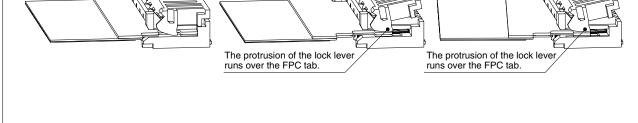



[Operation method]


4. How to unlock the lock lever

Push up the lock lever slowly, and release the lock. (Example 10)

- · When releasing the lock, operate the lock lever around the center. (Example 11)
- · When releasing the lock, do not operate only one side of the lock lever. (Example 12)
- · As the lock lever cannot be opened to over 45°, do not open it over this angle. (Example 13)
- · Do not pick and raise the lock lever off, or pull it. (Example 14)
- · Be sure to operate the lock lever by hand, and do not operate it with sharp-edged tools such as tweezers etc. (Example 15)
- · Don't apply an excessive force to the housing during operation. (Example 16)
- · The FPC insertion direction for this connector is different from the direction of the lock lever operation section. Do not try to open FPC from its insertion side. (Example 17)

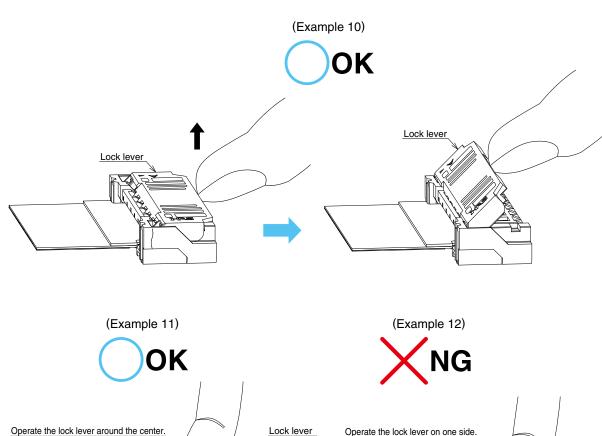

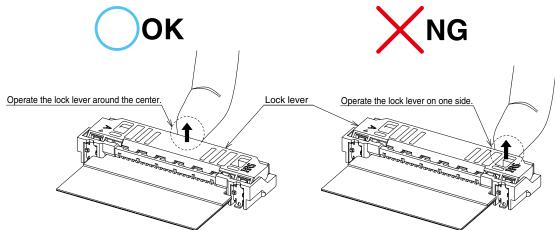

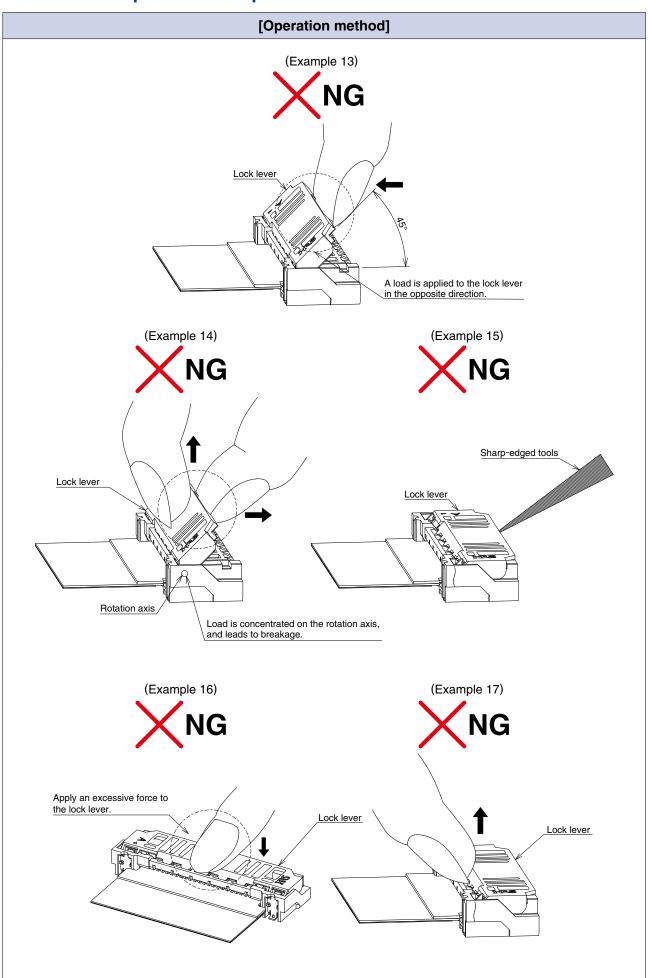


[Operation method]

5. How to remove FPC

After releasing the lock lever, remove the FPC in the horizontal direction. (Example 18) When removing the FPC, do not press the lock lever. (Example 19)

As the released lock lever automatically closes when removing the FPC, the lever does not need to be operated after removal. (Example 20)

- · Do not pull out FPC while the lever is locked. (Example 21)
- · This connector is equipped with the FPC retention mechanism by means of the lock lever. When pulling out FPC, do not apply load in the upward or lateral direction. (Example 22)

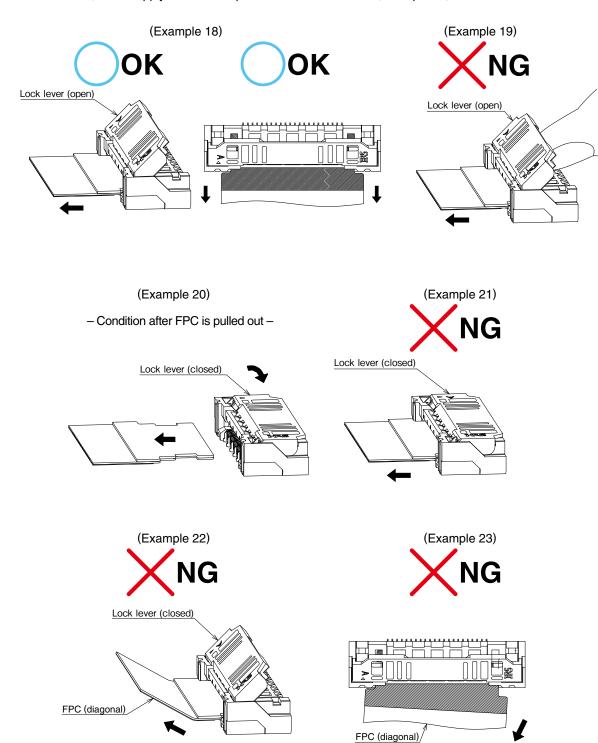



[Operation method]

[Cautions for PCB layout]

Depending on the routing of FPC to mate, a load may be applied to the connector, which could lead to failure. In order to prevent failure, please consider the following concerning the mechanism design.

- · When routing the FPC, please be careful that FPC is not pulled and routing is carried out with a margin.
- · Please check that the reinforcing film is placed horizontal to the board surface. (Example 23)
- · Please insure there is no load applied to the connector in the pulling, inserting or lateral direction. A bent FPC, it could cause contact failure or damage/disconnection of FPC. Therefore, please take some measure to fix FPC etc. (Example 24)(Example 25)
- · Don't place any parts under the FPC that will interfere with FPC. (Example 26)
- · As for the flexibility of FPC, please make adjustments with the FPC manufacturer.
- · Please ensure the FPC has adequate insertion space when designing the layout so that it is not inserted diagonally.
- Additionally, ensure the insertion space is not too short for FPC. Please adopt adequate parts layout and length for FPC.
- · When you design the board/layout, please secure a space required for operations.

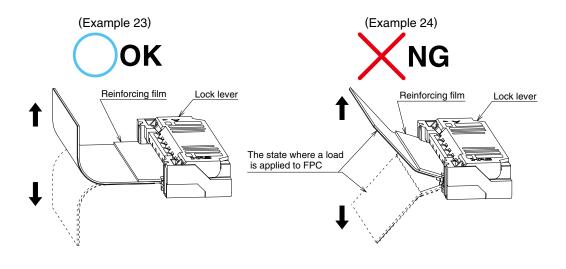

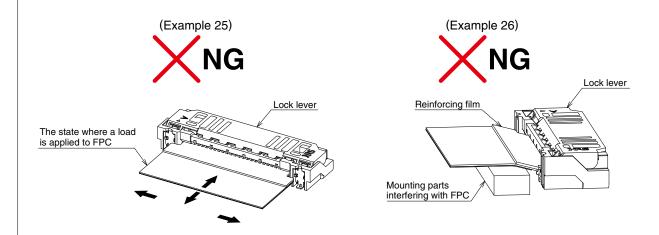

[Notes for mounting on the board/after mounting on the board]

[Notes for mounting on the board]

Please be careful of the following at the time of board mounting.

[Caution]

- Please confirm recommendations for mount board land shape, metal mask opening shape, and FPC shape.
- If the land is narrower than recommend, or if the metal mask opening is wider than recommend, solder (flux) wicking is more likely to occur.

If there is difference from the recommendation, please use check the mounted state.

The level difference between the bottom surfaces of contact lead and the mold is designed to be small. When there is silk print etc. on the bottom surface of the connector, it could push up the connector bottom surface, and cause non-sticking solder or defective fillet formation. When there is silk print etc. on the bottom surface of the connector, please use it after checking the

mounted state.

- Use the reflow conditions within the specifications of our company.
- The mounted status may vary due to external conditions such as the type of cream solder, manufacturer, and board size. Please use it after checking the mounted state.
- Please control the board warpage as much as possible. While the coplanarity of this connector is 0.1mm or less, defective soldering could occur if the board warpage is considerable.

 When mounted on FPC, be sure to provide a reinforcing plate to ease handling. We recommend a
- reinforcing plate of 0.3mm or thicker made of glass epoxy material.
- When pulling out the emboss from the reel, or when the connector is absorbed from the emboss and so on, do not apply any excessive external force (of 1N or more) to the connector before mounting.

[Cautions when handling the board after mounting]


Please be careful of the following when handling the board after mounting operation.

[Caution]

Do not apply any load to the board in the assembly process, such as "dividing a multi-piece board" or "securing the board to the frame".

Such action could apply a load to the connector and damage it.

· Use the board with the deflection being 1mm or less when the board width is 100mm. (Example 27) If the board has some deflection, it could apply a load to the connector and damage it.

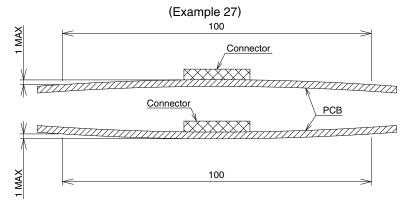

[Cautions for hand-soldering]

Please be careful of the following when hand-soldering for repair work etc.

- Do not hand-solder while FPC is inserted.
- · Please be careful not to apply excessive heat, or allow the solder iron to touch any place other than the connector contact lead.

Such action could cause the connector to be deformed or melted.

Do not supply an excessive amount of solder (flux).

If too much solder (flux) is supplied to the contact, the solder or flux could adhere on the contact point and cause contact failure.

Additionally, if you supply too much solder to the reinforcing metal tabs the rotational action of the lock lever could be defective and the connector could be damaged.



HIROSE ELECTRIC CO.,LTD.

2-6-3, Nakagawa Chuoh, Tsuzuki-Ku, Yokohama-Shi 224-8540, JAPAN TEL: +81-45-620-3526 Fax: +81-45-591-3726 http://www.hirose.com

http://www.hirose-connectors.com